

## CASE HISTORY Mercedes SLK 320

**VEHICLE FAULTS:-** ABS \ Traction lights on locked in park and non start.

**VEHICLE HISTORY:-** Vehicle suddenly had abs \ traction lights come on and stopped running .

**TESTING:-** A full Autologic test revealed no communication with the Traction control ECU, the main relay fuse had blown which also supplied the engine management and gear lever selector modules. Further investigation found that the wiring to the traction control ECU had chafed through on the inner wing causing a short circuit. After repairing the wiring it was found that the traction ECU had failed along with the stop lamp switch with all the parts replaced and the new control unit configured the car worked perfectly.



**Main wiring to traction control ECU**

